

FISHER

FISHER MANUFACTURING COMPANY TOLL FREE: 800-421-6162 - FAX: 800-832-8238
customer@fisher-mfg.com - www.fisher-mfg.com

PRODUCT NAME:

FAUCET 8" ADJUSTABLE WALL SERVICE SINK
SHORT SPOUT, ECCENTRIC STOPS
& VACUUM BREAKER

SPEC:FAHB-SSS-8SAWLL

Customer/Wholesaler:

Date:


Job Name:

Model Specified:

Quantity:

Contractor:

Architect/Engineer:

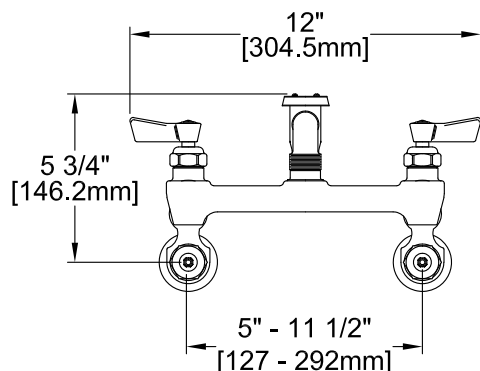

MODEL:

☐ 2453 FAUCET 8SAWLH 03SRV

OPTIONS OR MODIFICATIONS:

☐ OTHER _____

FEATURES

CONTROL VALVE

- * KEY-STOP ECCENTRICS ADJUST FROM 5" TO 11-1/2"
- * INTERNAL SPRING LOADED CHECK VALVES
- * SWIVELLING SEAT DISKS
- * HOT SIDE STEM - RIGHT HAND
- * COLD SIDE STEM - LEFT HAND
- * ECCENTRICS STEMS - RIGHT HAND - SWIVELLING

SEAT DISKS

- * STAINLESS STEEL SEATS
- * STAINLESS STEEL SEAT SCREWS
- * STAINLESS STEEL HANDLE SCREWS
- * ATMOSPHERIC VACUUM BREAKER

SYSTEM LIMITS

- * TEMP: 40°F MIN. TO 160°F MAX.
- * PRESSURE 200 PSI MAX. STATIC
- * 13.6 GPM AT 80 PSI (54.1 L/min @550 KPa)


SHIPPING WEIGHT

- * 6.75 LBS

PRODUCT COMPLIANCE:

- * ASME A112.18.1 / CSA B125.1

ROUGH-IN:

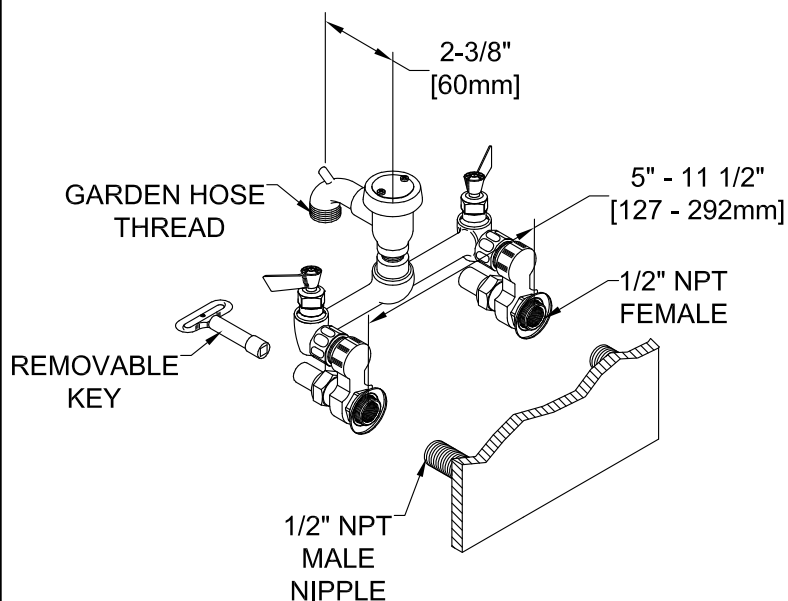

Drawn: DF


Checked: EM

Approved: DF

Date: 12/14/20

Sheet: 1 of 2

Replacement Parts for Service Sinks

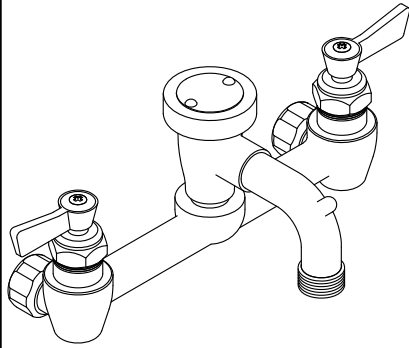


2453
SERVICE SINK FAUCET



2000-7500
SCREW



2000-8000
RED BUTTON
AND
2000-8001
BLUE BUTTON



LEVER HANDLE



2000-3002
BIBB CAP



73657
DUCK GASKET



2000-5000
WASHER



2000-6000
SPRING




2000-0001
RETAINER
ASSEMBLY




73521
LUBE


2000-0002
LEVER HANDLE KIT

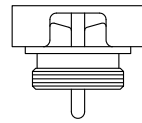


22004
VACUUM BREAKER
REPAIR KIT FOR
1/2" NPT



2000-0004
RH CHECK STEM
REPAIR KIT
OR
2000-0005
LH CHECK STEM
REPAIR KIT

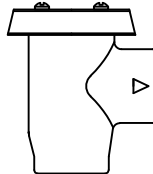

75117
VACUUM BREAKER
1/2" NPT




3200-2306
ECCENTRIC
FLANGES



3200-2307
1/2" ECCENTRICS



2200-5000
ECCENTRIC
GASKETS



73518
STOP KEY